A periodic surveillance must be conducted of each school building that contains ACBM or is assumed to contain ACBM at least once every 6 months. Visually inspect all areas that are identified in your AHERA Management Plan to observe current conditions. Note both damage and change in condition by circling the appropriate category below using the comment section for details. Date and sign this surveillance then submit a copy of the record to the Designate Person for inclusion in the AHERA Management Plan.

## DO NOT TOUCH ASBESTOS - CONTAINING MATERIAL WITHOUT PROPER TRAINING

Material	Location	Quantity	Damaged	Changed
Cement Asbestos Board	Chalkboards presumed throughout (none observed during inspection but may be obscured by cork boards or white boards)		Yes (No)	Yes (No)
Asbestos Pipe Insulation	Gym building, lower level (inaccessible areas)		Yes No	Yes No
Hard Fittings/Fiberglass	Gym building, lower level (inaccessible areas)		Yes No	Yes No
Fire Door	Throughout		Yes (No)	Yes No
Window Glazing Compound	Throughout gym lower level on exterior windows		Yes No	Yes No
O 1	ym with custodian. Most asbestos containing damage to a hard fitting/pipe in gym caused be		/e been rem	oved from
<b>^</b> 4	•		/e been rem	oved from
<b>3</b> 4	•		/e been rem	oved from
<b>3</b> 4	•		/e been rem	oved from
^ - · · · · · · · · · · · · · · · · · ·	•		/e been rem	oved from